



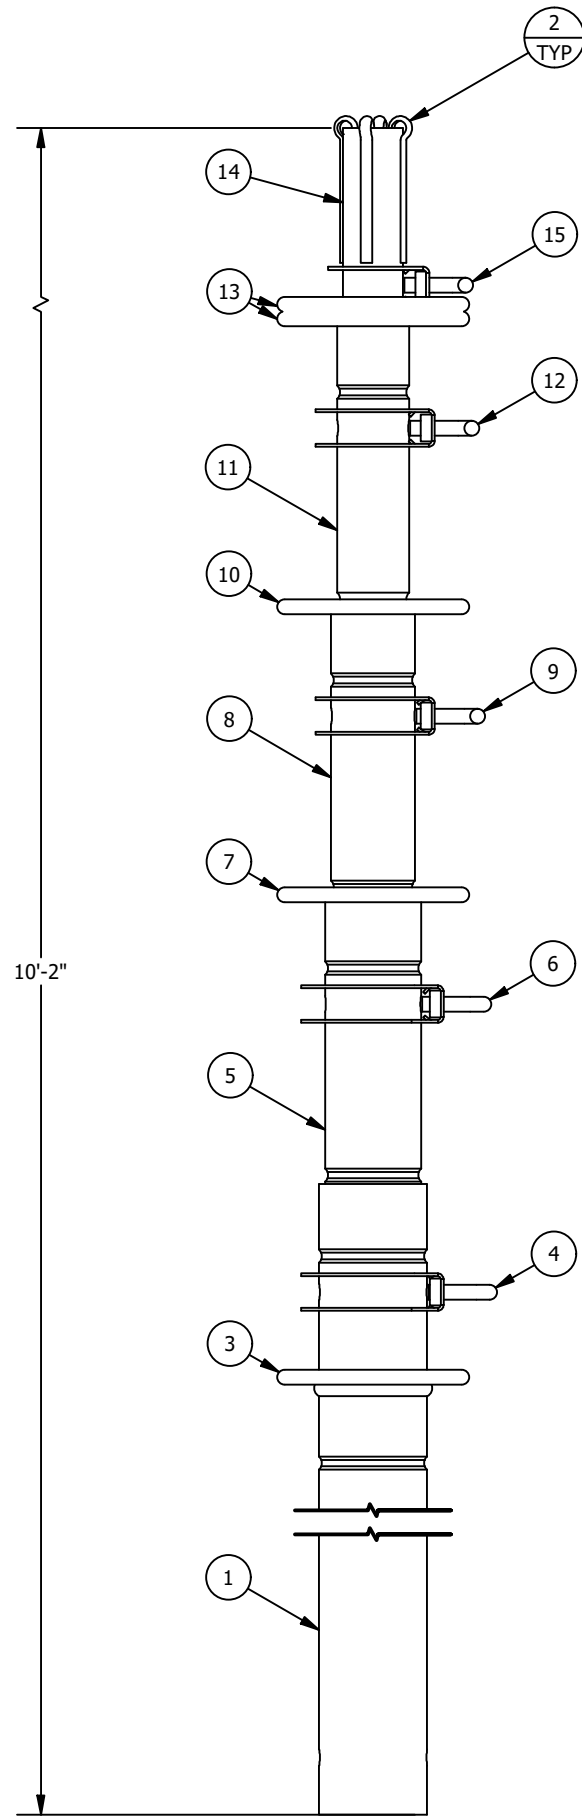

COLLAPSED VIEW

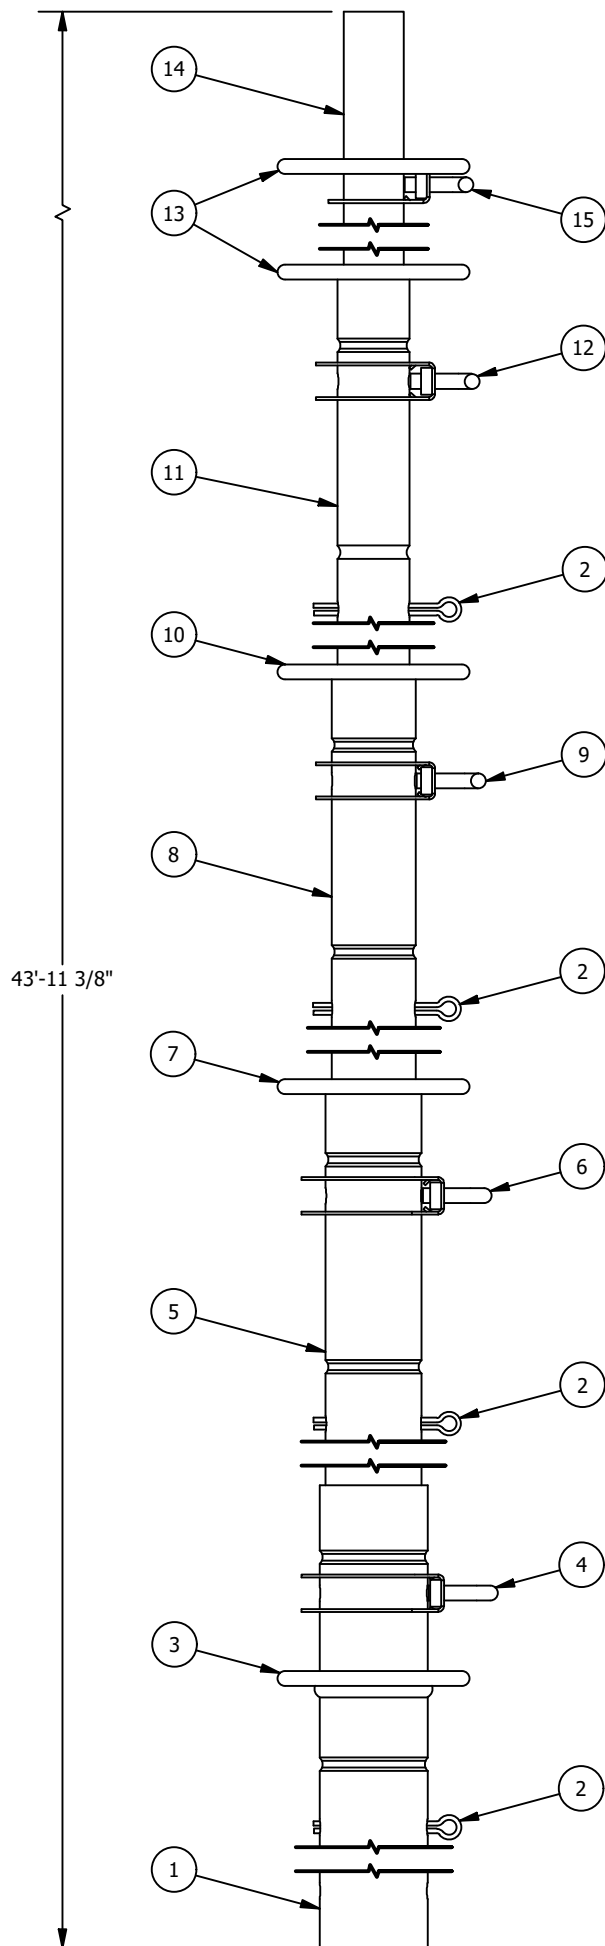

EXPANDED VIEW

ASSEMBLY P/N: H50

BILL OF MATERIALS			
ITEM	QTY	P/N	DESCRIPTION
1	1	KH899	TUBE 2.25ODX.049WX8.33' PG
2	4	280002	COTTER PIN 1/4X3 ZP
3	1	GR5	GUY RING 2-1/4 ROLLED EDGE
4	1	C5A	MAST CLAMP & L-BOLT ASSY 2-1/4
5	1	KH978	TUBE 2.00ODX.049WX6.83' PG
6	1	C4A	MAST CLAMP & L-BOLT ASSY 2"
7	1	GR3	GUY RING 1-3/4 ROLLED EDGE
8	1	KH977	TUBE 1.75ODX.049WX9.33' PG
9	1	C3A	MAST CLAMP & L-BOLT ASSY 1-3/4
10	1	GR2	GUY RING 1-1/2" ROLLED EDGE
11	1	KH976	TUBE 1.50ODX.049WX9.83' PG
12	1	C2A	MAST CLAMP & L-BOLT ASSY 1-1/2
13	2	GR1	GUY RING 1-1/4 ROLLED EDGE
14	1	KH890	TUBE 1.25ODX.065WX10.00' PG
15	1	C1A	MAST CLAMP & L-BOLT ASSY 1-1/4

NOTES

1. ALL PARTS AND HARDWARE ARE PRE-GALVANIZED.
2. ANTENNA LOAD (TOP LOAD) SHOULD NOT EXCEED 2 SQUARE FEET OF SURFACE. (SEE ANTENNA SPECIFICATIONS).
3. TELESCOPING MASTS ARE NOT RECOMMENDED FOR COMMERCIAL, HAM, CB, OR BEAM ANTENNAS.
4. SEE ROHN INSTALLATION GUIDELINES (SHEET 2) FOR MORE INFORMATION.

FILE NO.



P.O. BOX 5999
PEORIA, IL 61601-5999
TOLL FREE 800-727-ROHN

THIS DRAWING IS THE PROPERTY OF ROHN. IT IS NOT TO BE
REPRODUCED, COPIED OR TRACED IN WHOLE OR IN PART WITHOUT
OUR WRITTEN CONSENT.

TELESCOPING MAST ASSY
43'-11 3/8"

DWN: MJH	CHK'D: JEC	DATE: 4/13/2022
-------------	---------------	--------------------

ENG'R:	SHEET #: 1 OF 2
--------	--------------------

PRJ. ENG'R:	PRJ. MANG'R:
-------------	--------------

DRAWING NO: H50	REV: 0
--------------------	-----------

